



Sample 123 E Main St Gardena CA 90249

Sent: Tue, 08 Feb 2022 11:44


PREPARED BY:

Repair Pricer Team

QUESTIONS?
CLICK HERE TO GET HELP

Summary



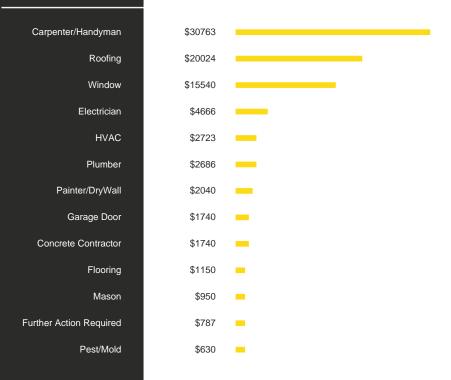

WHOLE PROPERTY REPORT:

The Whole Property Estimate Explained: You will notice that if you add every item on your report, the total will never match the Whole Property Estimate total. Why? By using custom calculations we work out not only the individual cost to fix each item, but also the projected cost if ONE contractor per trade were to visit the property and fix all the items at one time. Don't worry, your report is not incorrect and the prices are not meant to match the totals.

\$82,769



#	ltem	Pg	Action	Projected
	MACON			
1	MASON Stucco Missing in areas of the exterior	35	Patch wall covering in noted areas and seal to prevent moisture	\$950
'	Otable Missing in areas of the exterior	00	intrusion	φσσσ
			Sub-Total (Mason)	\$950
	CARPENTER/HANDYMAN	40		0.470
	Doors weathered/worn doors		Install new exterior door to improve safety and energy efficiency	\$473
	Vent Screens Gable vent screens damaged/missing		Install new screens	\$200
	Siding worn/weathered/cracked materials where visible recommend siding maintenance		Budget to replace entire siding and paint	\$25,450
5	Siding Gaps in siding at joints and around windows/doors	36	Pricing in adjacent defect. Budget to replace entire siding and	
	Ciding Detering and division	20	paint.	
6	Siding Deteriorated wood	36	Pricing in adjacent defect. Budget to replace entire siding and	
_		00	paint.	
/	Siding Heavily damaged needs to be replaced	36	Pricing in adjacent defect. Budget to replace entire siding and paint.	
8	Wood trim gaps present at some trim areas - recommend service and water tight maintenance	37	Service call to secure and seal affected areas	\$246
-	Wood Trim Deteriorated wood		Replace damaged areas and seal to prevent moisture intrusion	\$1,230
	Wood Hill Bolohoraled wood	31	and extend life of materials	ψ1,200
10	Eaves & Facia Deteriorated	38	Pricing in adjacent defect	
	Eaves & Facia Condensation/moisture damage		Replace and secure damaged areas noted to prevent moisture	\$1,584
	• · · · · · · · · · · · · · · · · · · ·		intrusion	, , , , ,
12	Eaves & Facia Damaged due to moisture	38	Pricing in adjacent defect	
	Exterior Paint Weathered and worn more than normal		Pricing in adjacent defect	•
14	Exterior paint blistered and peeling in areas -	39	Pricing in adjacent defect	
-	Exterior doors moisture damage		Replace and install exterior door	\$377
16	Patio and Porch Roof/s Wood deterioration observed - consult termite report	43	Change out rotten areas and seal to extend life of materials	\$800
17	Stairs & Handrails Handrail not proper size to be graspable -		Install graspable cap in noted areas	\$403
				•
			Sub-Total (Carpenter/Handyman)	\$30,763
	ELECTRICIAN			
10	ELECTRICIAN Electrical Outlet hot wired in reverse with neutral -	4.4	Sorvice call to reverse wiring	\$118
			Service call to reverse wiring	\$2,350
19	Electrical three prong outlets not grounded -	11	Install GFCI protection in noted areas or change back to 2 prong	\$∠,350
20	Electrical Outlet cover missing -	11	throughout Repair or install outlet, switch covers and secure throughout	\$171
20	Licothod Oddot 60v6 missing -	11	Tropan of motan outlet, switch covers and secure infoughout	ΨΙ/Ι



#	Item	Pg	Action	Projected
21	Electrical Outlet/switch cover damaged/missing	18	Pricing in adjacent defect	
22	Sub Panel/s Missing knockouts/twistouts -	21	Service panel as needed to improve safety	\$120
23	Sub Panel/s Evidence of water intrusion in the panel	21	Service noted items on sub panels	\$150
24	Cable feeds wiring to garage is weathered/worn/deteriorated	23	Service as needed to improve safety	\$490
25	Cable Feeds Drip loop heavily dammaged	23	Have electrician and power company coordinate install as needed	\$950
26	Electrical Open junction boxes - safety concern - recommend installing proper covers, as needed, for safety	32	Install and repair junction boxes as needed to improve safety	\$134
27	Electrical Exposed non-metallic sheathed (romex) wires below 8 feet -	32	Secure in conduit and service	\$183
28	Electrical Outlet/switch cover missing/damaged - recommend outlet and switch covers on all fixtures to prevent access to	32	Pricing in adjacent defect	
	wires/connections			
			Sub-Total (Electrician)	\$4,666
	PAINTER/DRYWALL	_		
	Walls peeling/blistered/cracking paint in areas		Touch up paint noted items	\$1,145
30	Walls Stains/blistered areas present - tested dry with moisture meter at time of inspection	7	After leak detection patch moisture damaged areas noted on the	\$895
			report	
31	Ceilings Stains/blistered areas present - tested dry with moisture meter		Pricing in adjacent defect	
	Walls Stains present - tested dry for moisture at time of inspectio		Pricing in adjacent defect	
33	Walls Evidence of moisture entering at base	30	Pricing in adjacent defect	
			Sub-Total (Painter/DryWall)	\$2.040
			Sub-Total (Fainter/Drywall)	\$2,040
	PLUMBER			
34	Bath Tub/s Drains operated slowly	12	Service as needed to make improvements	\$149
35	Sink/s Fixture leaks when operating	16	Repair and service fixtures noted	\$95
36	Plumbing Corrosion is present at plumbing areas - this is a sign of slow leaking and should be further evaluated by a plumber	17	Service and repair corrosion at piping to extend the life of	\$190
			materials	
37	Temperature Pressure Release Valve/s Visibly corroded	19	Pricing in adjacent defect. Included in replacement.	
38	Plumbing Direct hard pipe connections to water heater - recommend flexible connectors for optimal seismic event	19	Pricing in adjacent defect. Included in replacement.	
	performance/movement			
39	Water heater/s condition unit was not operating at the time of the inspection - we recommend that a licensed plumber evaluate the unit	19	Pricing in adjacent defect. Included in replacement.	
40	Water Heater/s Condition Unit old and nearing end of useful life - we recommend that you budget for a replacement	19	Budget to replace water heater	\$1,732
41	Strapping None/Missing - needs to be serviced - requires two 1 1/2" steel straps 16 gauge, 1/3 from the top and the bottom	20	Pricing in adjacent defect. Included in replacement.	
42	Overflow Line/s None	20	Pricing in adjacent defect. Included in replacement.	
43	Gas Pipe/s and Valve/s Significant rusting	24	Clean and service gas line to extend life of materials	\$520
			Sub-Total (Plumber)	\$2,686



#	ltem	Pg	Action	Projected
	HVAC			
	Window-Wall A/C or Heat Unit/s Did not operate		Pricing in adjacent defect. Included in replacement.	
45	Window-Wall A/C or Heat Unit/s Heavily damaged unit recommend replacement	9	Replace window units as needed	\$2,723
			Code Tatal (UNAC)	¢0.700
			Sub-Total (HVAC)	\$2,723
	ROOFING			
46	Rafters & Ceilings Stains present - tested dry at time of inspection - monitor for possible moisture intrusion	28	Pricing in adjacent defect. Included in replacement.	
47	Condition Exposed nails on roofing material - recommend sealing all fastener heads		Pricing in adjacent defect. Included in replacement.	
48	Condition Missing/damaged shingles/tiles at ridge/hip -		Pricing in adjacent defect. Included in replacement.	
49	Condition shingles exhibited moderate granule loss - normal for age of material		Remove roof and install new roof as needed to prevent moisture	\$19,704
			intrusion on noted roofs	, , , , , ,
50	Vents and vent cap/s worn/weathered recommend seasonal maintenance to ensure that caps do not become loose or develop other	49	Repair or install as needed	\$320
	defects		·	
			Sub-Total (Roofing)	\$20,024
	WINDOW			
51	Windows Stuck in position-	9	Pricing in adjacent defect. Included in replacement.	
52	Window deteriorated frames-	34	Budget to replace or upgrade noted windows	\$15,540
53	Window/s Broken pane-	34	Pricing in adjacent defect. Included in replacement.	
			Sub-Total (Window)	\$15,540
- 4	PEST/MOLD	•	AATT TO STORY	0000
	Window-Wall A/C or Heat Unit/s Mold like substance present suggest further investigation/test to confirm		Mold detection with a licensed indoor air quality specialist	\$630
55	Rafters & Ceilings Mold like substance present - testing needed to confirm Walls Mildew smell		Pricing in adjacent defect	
56	Walls Mildew Sfriell	30	Pricing in adjacent defect	
			Sub-Total (Pest/Mold)	\$630
			-ous rotal (rosumota)	
	GARAGE DOOR			
57	Main automotive door/s damaged/deteriorated	28	Replace and upgrade garage door	\$1,740
	•	-	, , , , , , , , , , , , , , , , , , , ,	,,,,,,,,,,,,,,,,,,,,,,,,,,,,,,,,,,,,,,,
			Sub-Total (Garage Door)	\$1,740
1			!	· I





#	ltem	Pg	Action	Projected
	CONCRETE CONTRACTOR			
58	Slab Worn heavily	32 Repair dete	riorated area of foundation cosmetic repair only	\$350
59	Parking lot/s/driveway/s and walkway/s driveway slopes towards structure- potential for water intrusion	42 Repair and	adjust to improve drainage as needed	\$900
60	Parking lot/s/driveway/s and walkway/s wood ribbons in concrete deteriorated and potential trip hazard	42 Grind down	trip hazard or mud jack area to improve safety and fill	\$490
		cracks with	MP1 caulk	
		0.1.7		04.740
		Sub-Total (Concrete Contractor)	\$1,740
	FLOORING			
61	Floors worn/stained heavily in areas	9 Budget to in	nstall r repair flooring where needed	\$1,150
		Sub-Total (Flooring)	\$1,150
	FURTHER ACTION REQUIRED			
62		44 Structural o	nainear or foundation appointing pooded to inspect	\$787
02	Foundation perimeter cracked more than typical		ngineer or foundation specialist needed to inspect	\$707
		Structural Si	upport and recommend repairs	
		Sub-Total (Further Action Required)	\$787

Thank you for choosing Repair Pricer

About Repair Pricer

Repair Pricer is the industry standard for converting inspection reports into accurate repair estimates during the complex property purchasing process, enabling all parties to act quickly and confidently during a critical period. Repair Pricer saves time and reduces stress for everyone when it matters most. To learn more about Repair Pricer, visit www.repairpricer.com



It is important you understand that the service provided by RepairPricer.com is purely for estimation and negotiation purposes. We do not guarantee that the prices we estimate for repairs on your report are the same that you will encure up paying for that specific repair. Our pricing is based on the average cost for a similar repair in your area, and due to unknown factors or underlying issues that we are not privy to, actual repair cost may be substantially higher.